






- 1. Single Survey
- 2. Energy Report
- 3. Property Questionnaire

survey report on:

Property address	Flat 0/1, 6 Firpark Close, Glasgow, G31 2HQ
Customer	Mr E Fraser
Customer address	Springrose, 19 Torgormack, Beauly, IV4 7AQ



Date of inspection	22nd May 2017
--------------------	---------------

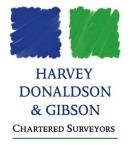

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

Х

The ultimate holding company of Harvey Donaldson & Gibson is Countrywide plc. In Scotland, Countrywide plc also own Slater Hogg & Howison and Countrywide North. A full list of estate agents owned or under franchise to Countrywide plc is available on request. Harvey Donaldson & Gibson trades as an entirely separate company and has no financial interest whatsoever in the disposal of the property being inspected.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Codes of Conduct.

Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information

contained in the Report and the generic Mortgage Valuation Report.²

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.1 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller:
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be

researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1 <u>Category 3:</u> Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	The subjects comprise a ground floor flat in a five storey block of eighteen constructed in 2005.
Accommodation	First floor: Entrance hall, open plan lounge/kitchen, two bedrooms, bathroom and en-suite shower room. There is on site residents parking.
Gross internal floor area (m²)	62sq.m
Neighbourhood and location	The property is located in a modern residential estate close to all amenities.
Age	12 years.
Weather	Dry
Chimney stacks	Visually inspected with the aid of binoculars where appropriate. None.

Roofing including roof space	Sloping roofs were visually inspected with the aid of binoculars where appropriate.
	Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally.
	Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.
	If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.
	The roof is flat and clad with a single ply water proof membrane. There was no access to the roof at the time of the inspection.
Rainwater fittings	Visually inspected with the aid of binoculars where appropriate.
	The gutters are integrated into the roof.
Main walls	Visually inspected with the aid of binoculars where appropriate.
	Foundations and concealed parts were not exposed or inspected.
	The main walls are timber framed with facing brick and rendered brick/block outer leaf. The walls are plasterboard lined internally.
Windows, external doors and joinery	Internal and external doors were opened and closed where keys were available.
	Random windows were opened and closed where possible.
	Doors and windows were not forced open.
	The windows are uPVC and double glazed. The door is timber.
External decorations	Visually inspected.
	External decorations are painted.
Conservatories / nerchas	Vigually inspected
Conservatories / porches	Visually inspected. None.
	NONG.
Communal areas	Circulation areas visually inspected.
	There is a common entrance and stairwell.
	There is a passenger lift to all floors.
Garages and permanent outbuildings	Visually inspected.
ages and permanent outbuildings	None.
Ī	110.10.

Γ	
Outside areas and boundaries	Visually inspected.
	There are open plan/common garden grounds to the front, side and rear of the property.
Ceilings	Visually inspected from floor level.
	The ceilings are plasterboard.
Into an al walle	
Internal walls	Visually inspected from floor level.
	Using a moisture meter, walls were randomly tested for dampness where considered appropriate.
	The internal walls are of timber studwork framed construction.
	The walls are lined with plasterboard.
Floors including sub floors	Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.
	Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.
	Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.
	The floor is suspended timber construction.
Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved.
	Kitchen units were visually inspected excluding appliances.
	The internal doors are flush faced timber fire units. The skirting boards and door surrounds are timber/MDF. The kitchen fittings are of a contemporary design and consist of a range of floor and wall mounted units.
Chimney broads and fire-lases	When the form of the
Chimney breasts and fireplaces	Visually inspected.
	No testing of the flues or fittings was carried out.
	None.
Internal decorations	Visually inspected.
_	Ceilings are painted.
	Walls are painted.
	Joinery is painted and finished with decorative stain.
	demony to painted and illustred with decorative stall.

Cellars	Visually inspected where there was a safe and purpose-built access.
	None.
Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.
	Mains electricity is installed. The meter and consumer unit are located in the hall cupboard. The system appears to be of a modern 13 amp type and design. The switch and socket outlets are plastic and the wiring is sheathed with PVC, where visible.
Gas	Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.
	Gas is supplied from the mains.
	The meters located in the hall cupboard.
Water, plumbing, bathroom fittings	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.
	No tests whatsoever were carried out to the system or appliances.
	Water is supplied from the mains and the external stop tap is located in the pavement. WATER DISTRIBUTION PIPES The distribution pipes are copper.
	BATHROOM FITTINGS There is a master bathroom with wash hand basin, bath with shower and WC and an en-suite shower room.
Heating and het water	According manta of the sustain man size it is a second
Heating and hot water	Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.
	No tests whatsoever were carried out to the system or appliances.
	The property is heated by a gas fired condensing boiler. The boiler is a combination boiler also providing hot water direct to taps. Heating to the rooms is provided by water filled radiators.
Drainage	Drainage covers etc were not lifted
- Lamage	Drainage covers etc were not lifted.
	Neither drains nor drainage systems were tested.
	The property is believed to be connected to mains drainage.

Fire, smoke and burglar alarms	Visually inspected.
	No tests whatsoever were carried out to the system or appliances.
	The property has a smoke detector.
	The property has a door entry system with intercom.

Any additional limits to inspection

For flats / maisonettes

Only the subject flat and internal communal areas giving access to the flat were inspected.

If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation.

The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance.

The furniture, stored items and personal effects within the property restricted our inspection.

Leakage and water penetration within roof spaces, around chimney breasts, window openings, etc are sometimes only visible during or immediately after, adverse weather conditions.

The property was inspected within the limits imposed by occupation which included, throughout, closely nailed and fixed fitted carpeting, floor coverings, stored items, furnishings etc. The owner's personal belongings were not removed from cupboards.

The property was occupied.

The property was furnished. Cupboards were full of stored goods which restricted the inspection.

Where walls are lined internally, for example with plasterboard or timber, the structure behind the lining could not be tested with an electronic moisture meter.

Not all windows were tested.

Concealed areas below sanitary fittings are not inspected.


Where there are fitted kitchen units the walls behind could not be tested with an electronic moisture meter.

The sub floor areas have not been inspected.

Where timbers are built into walls or otherwise concealed they cannot be inspected.

Whilst all reasonable care has been taken it must be accepted that there is a limit to the amount of potentially damaging probing that can be undertaken to the vendor's property.

Sectional Diagram showing elements of a typical house

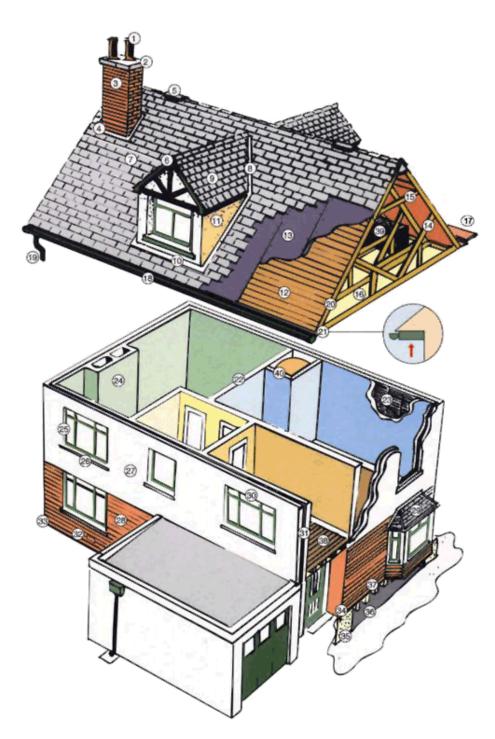

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

- 1) Chimney pots
- 2) Coping stone
- 3) Chimney head
- 4 Flashing
- 5 Ridge ventilation
- 6 Ridge board
- 7) Slates / tiles
- 8 Valley guttering
- 9 Dormer projection
- 10) Dormer flashing
- 11) Dormer cheeks
- (12) Sarking
- (13) Roof felt
- (14) Trusses
- (15) Collar
- 16 Insulation
- (17) Parapet gutter
- (18) Eaves guttering
- (19) Rainwater downpipe
- 20) Verge boards/skews
- 21) Soffit boards
- 22) Partition wall
- 23) Lath / plaster
- 24) Chimney breast
- 25) Window pointing
- 6) Window sills
- 27) Rendering
- (28) Brickwork / pointing
- 29) Bay window projection
- 30 Lintels
- (31) Cavity walls / wall ties
- 32) Subfloor ventilator
- 33) Damp proof course
- 34) Base course
- 35) Foundations
- 36) Solum
- Floor joists
- 38) Floorboards
- (39) Water tank
- 40) Hot water tank

2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural movement	
Repair category	1
Notes	No visible evidence of significant structural movement was noted within the limitations of the inspection.

Dampness, rot and infestation	
Repair category	1
Notes	None noted within the limitations of the inspection.

Chimney stacks	
Repair category	-
Notes	N/A.

Roofing including roof space	
Repair category	1
Notes	The flat roof covering could not be seen. There was no evidence of defects internally to indicate that it is any thing other than satisfactory.

Rainwater fittings	
Repair category	1
Notes	The rainwater goods are satisfactory.

Main walls	
Repair category	1
Notes	The main walls are satisfactory allowing for normal weathering. There are one or two hairline cracks through the external render. These do not appear to be of any structural significance.

Windows, external doors and joinery	
Repair category	1
Notes	The windows and doors are satisfactory.

External decorations	
Repair category	1
Notes	The external paintwork finishes are in reasonable condition but are beginning to deteriorate.

Conservatories/porches	
Repair category	-
Notes	N/A.

Communal areas	
Repair category	1
Notes	The shared entrance and stair well are satisfactory. The lift was working at the time of the inspection. The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance.

Garages and permanent outbuildings	
Repair category	-
Notes	N/A.

Outside areas and boundaries	
Repair category	1
Notes	The outside areas and boundaries are satisfactory for age and type.

Ceilings	
Repair category	1
Notes	The ceilings are satisfactory.

Internal walls	
Repair category	1
Notes	The internal walls are satisfactory.

Floors including sub-floors	
Repair category	1
Notes	The floors where visible are satisfactory.

Internal joinery and kitchen fittings	
Repair category	1
Notes	The Internal Joinery is satisfactory. The skirting boards and door surrounds are satisfactory. The kitchen units are satisfactory. The internal doors are satisfactory.

Chimney breasts and fireplaces		
Repair category	-	
Notes	N/A.	

Internal decorations	
Repair category	1
Notes The internal decorations are satisfactory.	

Cellars	
Repair category	-
Notes	N/A.

Electricity	
Repair category	1
Notes	It is recommended good practice that all electrical installations should be checked periodically, approximately every ten years or when a property changes hands. This should be regarded as a routine safety and maintenance check.

Gas	
Repair category	1
Notes	The gas installation appears to be generally commensurate with the age of the installation. The gas meter and supply should be checked on an annual basis.

Water, plumbing and bathroom fittings		
Repair category	1	
Notes	The plumbing installation appeared satisfactory. The sanitary fittings appeared satisfactory.	

Heating and hot water		
Repair category	1	
Notes	The system was switched off at the time of inspection, but no obvious defects were noted.	
	It is recommended good practice that gas boilers are serviced on an annual basis by an appropriately qualified person. The boiler's service history should be checked by referring to the service records. If there is no record of a recent service, the boiler should be checked by an appropriately qualified person.	

Drainage	
Repair category	1
Notes	The above ground drainage pipes appeared satisfactory.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	-
Roofing including roof space	1
Rainwater fittings	1
Main walls	1
Windows, external doors and joinery	1
External decorations	1
Conservatories/porches	-
Communal areas	1
Garages and permanent outbuildings	-
Outside areas and boundaries	1
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	-
Internal decorations	1
Cellars	-
Electricity	1
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground Floor
2. Are there three steps or fewer to a main entrance door of the property?	Yes X No
3. Is there a lift to the main entrance door of the property?	Yes X No
4. Are all door openings greater than 750mm?	Yes X No
5. Is there a toilet on the same level as the living room and kitchen?	Yes X No
6. Is there a toilet on the same level as a bedroom?	Yes X No
7. Are all rooms on the same level with no internal steps or stairs?	Yes X No
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes X No

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

The tenure is understood to be outright ownership.

In line with our normal practice, it is specifically assumed that the property and its value are unaffected by any matters which would or should be revealed to a competent Completing Solicitor by a local search and replies to the usual enquiries, or by any statutory notice and planning proposals.

The property is situated in an area of past mining activity. The legal adviser should obtain a mining report from the coal authority and ensure that the requirements of the Coal Mining Subsidence Acts have been complied with.

The management and service charge details have not been inspected and it is assumed it does not contain onerous provisions which would adversely affect valuation.

Estimated	d reinstat	ement cost	t for insi	urance pu	rposes
-----------	------------	------------	------------	-----------	--------

£110,000 (One Hundred and Ten Thousand Pounds Sterling).

Valuation and market comments

In its present condition the opinion of valuation for the Outright Ownership interest of the property with vacant possession on 22nd May 2017 is £130,000(one hundred and thirty thousand pounds sterling).

Signed	Security Print Code [433240 = 5499] Electronically signed	
Report author	Graeme Cowan	
Company name	Harvey Donaldson And Gibson	
Address	Suite 3/7 Standard Buildings, 94 Hope Street, Glasgow, G2 6PH	



B () ()	
Property Address	
Address	Flat 0/1, 6 Firpark Close, Glasgow, G31 2HQ
Seller's Name	Mr E Fraser
Date of Inspection	22nd May 2017
Property Details	
Property Type	House Bungalow Purpose built maisonette Converted maisonette
	X Purpose built flat Converted flat Tenement flat Flat over non-residential use
	Other (specify in General Remarks)
Property Style	Detached Semi detached Mid terrace End terrace
. , ,	Back to back High rise block X Low rise block Other (specify in General Remarks)
Does the surveyor be e.g. local authority, m	lieve that the property was built for the public sector, Yes X No
Flats/Maisonettes onli	
Tidio/Maiooriottoo c	No. of units in block 18
Approximate Year of	
Tenure	
X Absolute Ownership	Leasehold Ground rent £ Unexpired years
Accommodation	
Number of Rooms	1 Living room(s) 2 Bedroom(s) 1 Kitchen(s)
	2 Bathroom(s) 2 WC(s) 0 Other (Specify in General remarks)
Gross Floor Area (exc	cluding garages and outbuildings) 62 m² (Internal) 72 m² (External)
Residential Element (greater than 40%) X Yes No
Garage / Parking /	Outbuildings
Single garage	Double garage X Parking space No garage / garage space / parking space
Available on site?	X Yes No
Permanent outbuildin	gs:

Construction							
Walls	Brick	Stone	Concrete	X Timber frame	Other	(specify in Gen	eral Remarks)
Roof	Tile	Slate	Asphalt	Felt	X Other	(specify in Gen	eral Remarks)
Special Risks							
Has the property su	ffered struct	ural movement	?			Yes	X No
If Yes, is this recent	or progress	ive?				Yes	No
Is there evidence, h immediate vicinity?	istory, or rea	son to anticipa	te subsidence,	heave, landslip o	r flood in the	Yes	X No
If Yes to any of the	above, provi	de details in Ge	eneral Remarks	5.			
Service Connecti	on						
Based on visual ins of the supply in Ger			appear to be	non-mains, please	e comment or	n the type ar	nd location
Drainage [X Mains	Private	None	Water	X Mains	Private	None
Electricity [X Mains	Private	None	Gas	X Mains	Private	None
Central Heating [X Yes	Partial	None				
Brief description of	Central Heat	ing:					
Full Gas System.							
6:4-							
Site							
Apparent legal issue			,	•	<u>.</u>		
	X Shared drive			amenities on separate	_	ed service conn	
Ill-defined boundaries	5	Agricultura	l land included wit	n property	U Otner	(specify in Gel	neral Remarks)
Location							
Residential suburb	X Resi	dential within town	/ city Mixed	d residential / commer	cial Mainly	y commercial	
Commuter village	Rem	note village	Isolat	ed rural property	Other	(specify in Ge	neral Remarks)
Planning Issues							
Has the property be	en extended	I / converted / a	ıltered? 🔲 Y	es X No			
If Yes provide detail	ls in General	Remarks.					
Roads							
X Made up road	Unmade road	Partly cor	mpleted new road	Pedestrian ad	ccess only	Adopted	Unadopted

General Remarks
The subjects comprise a first floor flat in a five storey block of eighteen constructed in 2005. The property is located in a modern residential estate close to all amenities.
The roof is flat and clad with a single ply water proof membrane.
The general condition of the property appears consistent with its age and type of construction.
Essential Repairs
None.
Estimated cost of essential repairs £ Retention recommended?YesX No Amount £

Comment on Mortgagea	bility	
The property is considered	d readily mortgageable.	
Valuations		
Market value in present cor	adition	£ 130,000
Market value on completion		£
Insurance reinstatement va	•	£ 110,000
	rebuilding, site clearance, professional fees, ancillary charges plus VAT)	~ [110,000
Is a reinspection necessary	?	Yes X No
Buy To Let Cases		
What is the reasonable rangmonth Short Assured Tenar	ge of monthly rental income for the property assuming a letting on a 6 ncy basis?	£
Is the property in an area w	here there is a steady demand for rented accommodation of this type?	Yes No
Declaration		
Beolaration		
Signed	Security Print Code [433240 = 5499] Electronically signed by:-	
Surveyor's name	Graeme Cowan	
Professional qualifications	BSc (Hons) MRICS	
Company name	Harvey Donaldson And Gibson	
Address	Suite 3/7 Standard Buildings, 94 Hope Street, Glasgow, G2 6PH	
Telephone	0141 204 0808	
Fax	0141 248 3636	
Report date	25th May 2017	

Energy Performance Certificate (EPC)

Dwellings

Scotland

FLAT 0/1, 6 FIRPARK CLOSE, GLASGOW, G31 2HQ

Dwelling type:Ground-floor flatDate of assessment:22 May 2017Date of certificate:22 May 2017Total floor area:62 m²

Primary Energy Indicator: 187 kWh/m²/year

Reference number: 1413-2325-8000-0052-1926 **Type of assessment:** RdSAP, existing dwelling

Approved Organisation: Elmhurst

Main heating and fuel: Boiler and radiators, mains


aas

You can use this document to:

- . Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£1,572	See your recommendations
Over 3 years you could save*	£342	report for more information

^{*} based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

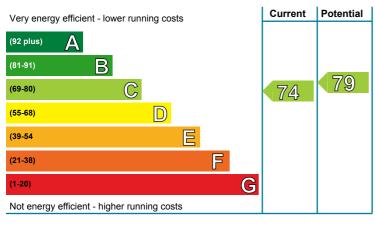


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band C (74)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

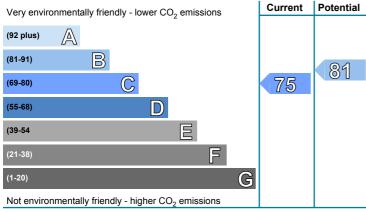

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO_2) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band C (75)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years	Available with Green Deal
1 Floor insulation (suspended floor)	£800 - £1,200	£63.00	Ø
2 Low energy lighting	£50	£120.00	
3 Condensing boiler	£2,200 - £3,000	£159.00	Ø

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.



The Green Deal may allow you to make your home warmer and cheaper to run at no up-front capital cost. See your recommendations report for more details.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Timber frame, as built, insulated (assumed)	★★★★☆	★★★★ ☆
Roof	(another dwelling above)	_	_
Floor	Suspended, insulated (assumed)	_	_
Windows	Fully double glazed	★★★★☆	★★★★ ☆
Main heating	Boiler and radiators, mains gas	★★★★☆	★★★★ ☆
Main heating controls	Programmer, room thermostat and TRVs	★★★★☆	★★★★ ☆
Secondary heating	None	_	_
Hot water	From main system	★★★★☆	★★★★ ☆
Lighting	No low energy lighting	****	***

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 33 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 2.0 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 0.5 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£942 over 3 years	£804 over 3 years	
Hot water	£342 over 3 years	£282 over 3 years	You could
Lighting	£288 over 3 years	£144 over 3 years	save £342
Totals	£1,572	£1,230	over 3 years

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Da		Indicative cost	Typical saving	Rating after	improvement	Green
Re	commended measures	Indicative cost	per year	Energy	Environment	Deal
1	Floor insulation (suspended floor)	£800 - £1,200	£21	C 75	C 76	
2	Low energy lighting for all fixed outlets	£50	£40	C 77	C 78	
3	Replace boiler with new condensing boiler	£2,200 - £3,000	£53	C 79	B 81	


Measures which have a green deal tick or are likely to be eligible for Green Deal finance plans based on indicative costs. Subsidy also may be available for some measures, such as solid wall insulation. Additional support may also be available for certain households in receipt of means tested benefits. Measures which have an orange tick may need additional finance. To find out how you could use Green Deal finance to improve your property, visit www.greenerscotland.org or contact the Home Energy Scotland hotline on 0808 808 2282.

Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

- Biomass boiler (Exempted Appliance if in Smoke Control Area)
- Air or ground source heat pump

Choosing the right improvement package

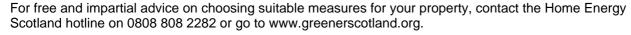



About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check this with your local authority building standards department.

2 Low energy lighting

Replacement of traditional light bulbs with energy saving recommended ones will reduce lighting costs over the lifetime of the bulb, and they last up to 12 times longer than ordinary light bulbs. Also consider selecting low energy light fittings when redecorating; contact the Lighting Association for your nearest stockist of Domestic Energy Efficient Lighting Scheme fittings.

3 Condensing boiler

A condensing boiler is capable of much higher efficiencies than other types of boiler, meaning it will burn less fuel to heat this property. This improvement is most appropriate when the existing central heating boiler needs repair or replacement, however there may be exceptional circumstances making this impractical. Condensing boilers need a drain for the condensate which limits their location; remember this when considering remodelling the room containing the existing boiler even if the latter is to be retained for the time being (for example a kitchen makeover). Building regulations generally apply to this work and a building warrant may be required, so it is best to obtain advice from your local authority building standards department and from a qualified heating engineer.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

You could receive Renewable Heat Incentive (RHI) payments and help reduce carbon emissions by replacing your existing heating system with one that generates renewable heat and, where appropriate, having your loft insulated and cavity walls filled. The estimated energy required for space and water heating will form the basis of the payments. For more information go to www.energysavingtrust.org.uk/scotland/rhi.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	3,495	N/A	N/A	N/A
Water heating (kWh per year)	1,882			

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name: Mr. Graeme Cowan

Assessor membership number: EES/016273

Company name/trading name: Harvey Donaldson & Gibson Chartered Surveyors Suite 3/7 Standard Buildings 94 Hope Street

Glasgow G2 6PH

Phone number: 0141 2040808

Email address: graeme.cowan@hdg.co.uk

Related party disclosure: No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Opportunity to benefit from a Green Deal on this property

Under a Green Deal, the cost of the improvements is repaid over time via a credit agreement. Repayments are made through a charge added to the electricity bill for the property.

To see which improvements are recommended for this property, please turn to page 3. You can choose which improvements you want to install and ask for a quote from an authorised Green Deal provider. They will organise installation by an authorised Green Deal installer. If you move home, the responsibility for paying the Green Deal charge under the credit agreement passes to the new electricity bill payer.

For householders in receipt of income-related benefits, additional help may be available.

To find out more, visit www.greenerscotland.org or call 0808 808 2282.

Authorised home energy assessment

Finance at no upfront cost

Choose from authorised installers May be paid from savings in energy bills

Repayments stay with the electricity bill payer

Property Questionnaire

Property Address	0/1 6 Firpark Close
	GLASGOW
	G31 2HQ

Seller(s) Mr Euan Fraser

Completion date of property questionnaire	21/05/2017
---	------------

1	Length of ownership How long have you owned the property? 3 years				
2	Council tax Which Council Tax band is your property in?				
3	Parking What are the arrangements for parking at your property? (Please tick all that apply) Garage □ Allocated parking space ☑ Driveway □ Shared parking □ On street □ Resident permit □ Metered parking □ Other (please specify)				
4	Conservation area Is your property in a designated Conservation Area (that is an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)? No				
5	Listed buildings Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)? No				
6 a.(i)	Alterations/additions/extensions During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)? No If you have answered yes, please describe below the changes which you have made:				
(ii)	Did you obtain planning permission, building warrant, completion certificate and other consents for this work?				
	If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking. If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:				

Have you had replacement windows, doors, patio doors or double glazing installed in your

b.

property?

No

- If you have answered yes, please answer the three questions below:
- (i) Were the replacements the same shape and type as the ones you replaced?
- (ii) Did this work involve any changes to the window or door openings?
- (iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed):

Please give any guarantees which you received for this work to your solicitor or estate agent.

7 Central heating

a. Is there a central heating system in your property?

(Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom).

Yes

If you have answered yes or partial — what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).

gas fired

If you have answered yes, please answer the three questions below:

- (i) When was your central heating system or partial central heating system installed?

 Assumed original
- (ii) Do you have a maintenance contract for the central heating system?

If you have answered yes, please give details of the company with which you have a maintenance contract:

(iii) When was your maintenance agreement last renewed? (Please provide the month and year).

8 Energy Performance Certificate

Does your property have an Energy Performance Certificate which is less than 10 years old?

Yes

9 Issues that may have affected your property

a. Has there been any storm, flood, fire or other structural damage to your property while you have owned it?

No

If you have answered yes, is the damage the subject of any outstanding insurance claim?

b. Are you aware of the existence of asbestos in your property?

No

If you have answered yes, please give details:

10 Services

Please tick which services are connected to your property and give details of the supplier:

	Services	Connected	Supplier
	Gas or liquid petroleum gas	$\overline{\checkmark}$	Scottish Hydro
	Water mains or private water supply	$\overline{\checkmark}$	Scottish Water
	Electricity	$\overline{\checkmark}$	Scottish Hydro
	Mains drainage	$\overline{\checkmark}$	Scottish Water
	Telephone	$\overline{\checkmark}$	TalkTalk
	Cable TV or satellite		
	Broadband	$\overline{\checkmark}$	TalkTalk
Is there a septic tank system at your property?			

b.

No

- Do you have appropriate consents for the discharge from your septic tank? (i)
- Do you have a maintenance contract for your septic tank? (ii)

If you have answered yes, please give details of the company with which you have a maintenance contract:

11 Responsibilities for shared or common areas

Are you aware of any responsibility to contribute to the cost of anything used jointly, such as a. the repair of a shared drive, private road, boundary, or garden area?

Yes

If you have answered yes, please give details:

Shared costs between all blocks at Firpark Close

Is there a responsibility to contribute to repair and maintenance of the roof, common b. stairwell or other common areas?

If you have answered yes, please give details:

Shared costs between all flats at No 6

Has there been any major repair or replacement of any part of the roof during the time you C. have owned the property?

No

d. Do you have the right to walk over any of your neighbours' property — for example to put out your rubbish bin or to maintain your boundaries?

Yes

If you have answered yes, please give details:

Shared grounds

As far as you are aware, do any of your neighbours have the right to walk over your e. property, for example to put out their rubbish bin or to maintain their boundaries? Yes

If you have answered yes, please give details:

Shared grounds

f. As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.)

No

If you have answered yes, please give details:

12 Charges associated with your property

a. Is there a factor or property manager for your property?

Yes

Newton Property Factors. £1000 to £1100/annum

b. Is there a common buildings insurance policy?

Yes

If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?

Yes

c. Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.

13 Specialist works

a. As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?

No

If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.

b. As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?

No

If you have answered yes, please give details:

c. If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?

If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate., these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.

Guarantees are held by:

14 Guarantees

- a. Are there any guarantees or warranties for any of the following:
- (i) Electrical work

Don't know

(ii) Roofing

Don't know

(iii) Central heating

No

(iv) National House Building Council (NHBC)

Don't know

(v) Damp course

Don't know

(vi) Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)

Don't know

- b. <u>If you have answered 'yes'</u> or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):
- (i) Electrical work
- (ii) Roofing
- (iii) Central heating
- (iv) National House Building Council (NHBC)
- (v) Damp course
- (vi) Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)
- c. Are there any outstanding claims under any of the guarantees listed above?

If you have answered yes, please give details:

15 Boundaries

So far as your are aware, has any boundary of your property been moved in the last 10 years?

No

If you have answered yes, please give details:

16 Notices that affect your property

In the past three years have you ever received a notice:

- a. advising that the owner of a neighbouring property has made a planning application?
 No
- b. that affects your property in some other way?
- c. that requires you to do any maintenance, repairs or improvements to your property?

If you have answered yes to any of a–c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.